


Quick Start Guide – PS1000 Pressure Sensor

Procedures for connecting and configuring the Greenspan PS1000 Sensor. Further details in the Sensor Manual included on the Greenspan CD.


You should have received:

- Certificate of Conformance Sheet
- CD Manuals & Software
- Greenspan PS1000 Sensor
- Cable Options per order

Wiring for 4-20mA Output Sensor

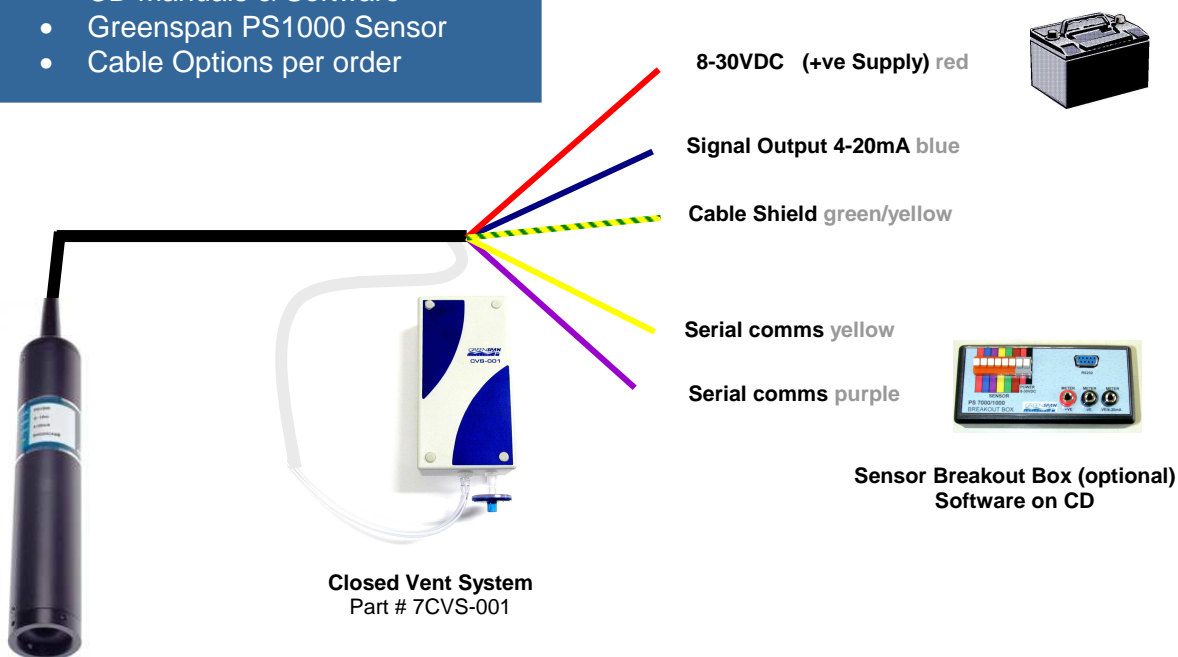

Sensor may be fitted with optional removable cable

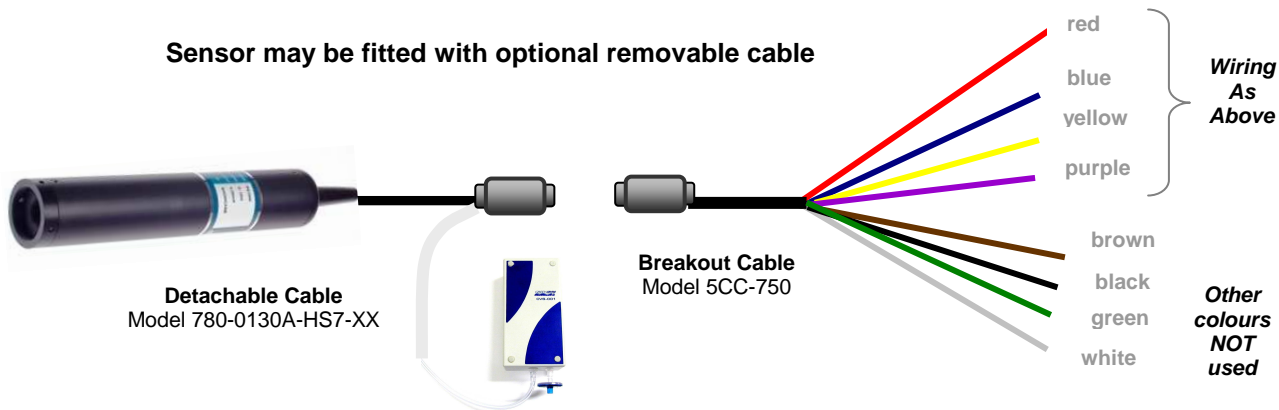

PS1000 provides a calibrated analogue output –4-20mA over the Sensor Full Scale range. (eg 0-10m.)
Sensor requires a nominal 12V DC power supply, but will operate from 8-30V DC.

Sensor output can be re ranged or the calibration adjusted using the Sensor Breakout Box and supplied software.
(Refer Breakout Box Quick Start Guide & Manual)